



# SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"  
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

October 1, 1946

TO ALL WURLITZER DISTRIBUTORS:

ATTENTION: SERVICE MANAGER

On all Model 1017's having a serial number between 1,918,001 and 1,918,299 it will be necessary to reverse the RED and YELLOW leads from the transformer in the Junction Box.

The incorrect wiring gives you trouble when you attempt to operate Model 3020 three wire system, wall boxes. Wall boxes on a line from terminal strip "B" of stepper will function properly and those on a line from terminal strip "A" of stepper will not operate. Switching the two wires corrects phasing in this circuit.

Correct position for connection of these secondary leads are as indicated below:

