



SERVICE SLANTS

YOUR QUESTIONS OR COMMENTS ON "SERVICE SLANTS"
ARE WELCOME AT ANY TIME

ISSUED BY WURLITZER SERVICE DEPT., NORTH TONAWANDA, N. Y.

SUBJECT: Model 1250 - Noise in Sound System During Change Cycle

1. The first run of phonographs, approximately 150, may develop the above symptoms due to an existing potential between the mechanism and the sound system chassis pan. To correct this condition, attach a 15" bonding strip or piece of zip-cord (both wires) to the right side at the front of the cabinet and bond one end under the amplifier mounting plate and the other end under the chassis side plate.
2. Check the muting switch adjustment carefully to make sure it is closing when the changer motor is operating.
3. The tone arm shift switches should have approximately 30 grams contact pressure when closed to avoid sensitivity to vibrations at this point. In case the blades of this switch have been accidentally bent in their mounting and there is insufficient contact pressure, dismount the blades and draw them out, forming a curve that will provide 30 grams contact pressure when re-mounted in the stack.