

service information

WURLITZER

Deutsche Wurlitzer GmbH

SI-MA-41a

4995 STEMWEDE 1 · ALTER POSTWEG 408 · TEL.: (0 57 45) 280 · TELEFAX: (0 57 45) 28 20

OMT CD, Hideaway CD, Carnegie

Greifarm bleibt bei tiefen Temperaturen nicht in Spielstellung stehen

Falls bei niedrigen Temperaturen der Greifarm nicht in Spielstellung (Platte auf CD-Spieler) bleibt, sondern die CD gleich wieder in den Korb zurücklegt, ist der Selbsthaltekontakt des Getriebemotors zu justieren.

Der Selbsthaltekontakt ist von der Chassisunterseite erreichbar. Der vordere Teil ist mit einer kleinen Flachzange so zu korrigieren, daß nur die Kontaktniete (Fig. A) und nicht die Abknickung (Fig. B) auf der Kontaktscheibe aufliegen.

Gripper arm motor overruns the play position by low ambient temperature

If the gripper arm does not stop in play position after a selection and returns the CD immediately to basket position, the self holding slide contact of the gear cam has to be re-adjusted. The slide contact (K1) is reachable from underneath the chassis. Flatten the front bend of the slide contact with a flat-nose pliers to ensure that the contact nozzles are only touching the disc (Fig. A) and not the bend (Fig. B).

b.w./p.t.o./t.s.v.p

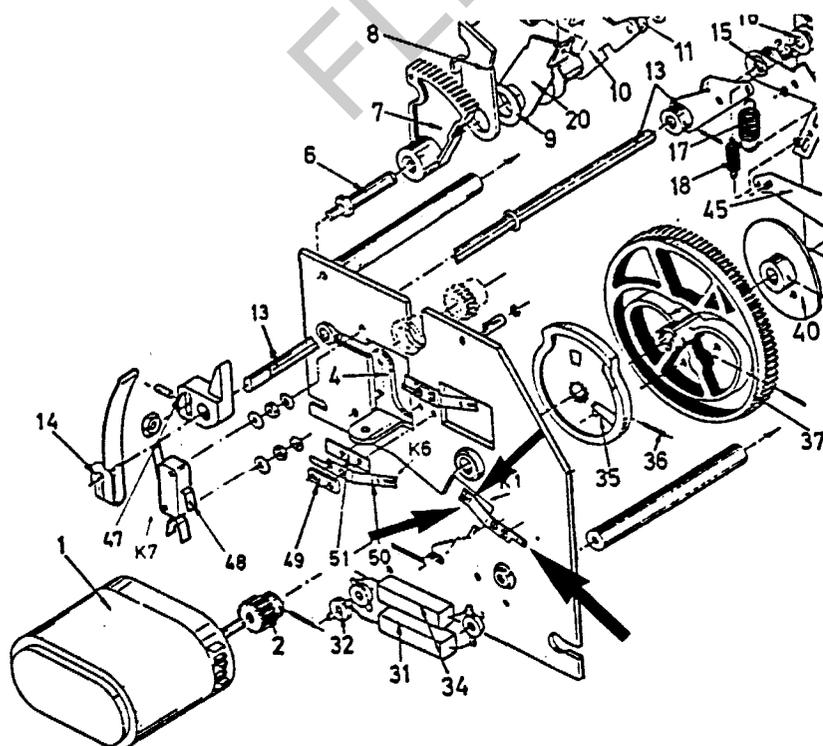


Fig. B

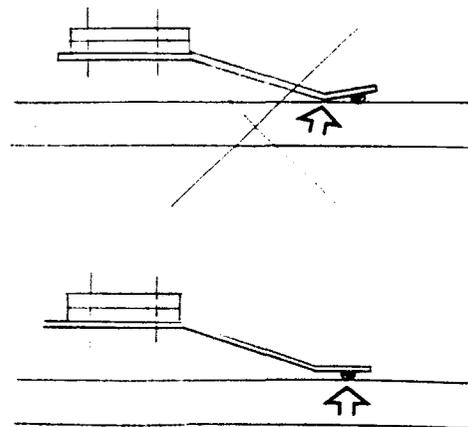


Fig. A